

# **PDV-P8107**

# **Light Dependent Resistor (LDR) CdS Photocell**

The PDV-P8107 CdS photocell has a minimum of  $20M\Omega$  dark resistance, packaged in a two leaded plastic-coated ceramic header.

Advanced Photonix's CdS Photocells are photoresistors measuring visible light from 400 to 700nm. Their resistance decreases as the light level increases with efficiency characteristics similar to the human eye. These Light Dependent Resistors (LDR) are available in a wide range of resistance values. They are available in a two-leaded plastic-coated ceramic header or hermetically sealed TO metal cans.

Applications	Features
Camera Exposure	Visible Light Response
Shutter Controls	Sintered Construction
Night Light Controls	20MΩ Dark Resistance





# Absolute Maximum Ratings at T<sub>A</sub>=23 °C


Parameter	Symbol	Min	Max	Unit		
Voltage (peak AC or DC)	$V_p$	-	150	V		
Power Dissipation at 25°C1	-	-	100	mW		
Operating Temperature	T <sub>OP</sub>	-30	+75	°C		
Storage Temperature	T <sub>STG</sub>	-30	+75	°C		
Package	2-pin Ceramic					

<sup>&</sup>lt;sup>1</sup>Derate linearly to 0 at 75°C.

# Typical Electro-Optical Specifications at $T_A$ =23 °C

Parameter	Test Conditions	Symbol	Min	Тур	Max	Unit
Dark Resistance	After 10sec. @10Lux @2856°K	$R_{_{D}}$	20	-	-	ΜΩ
Spectral Application Range	Flooded	λ	400	520	700	nm
Illuminated Resistance	10Lux@2856°K	$R_{_IL}$	80	-	240	ΚΩ
Sensitivity	Log(R100) - Log(R10)** Log(E100) - Log(E10)***	S	-	0.90	-	Ω/Lux
Rise Time	10Lux @2856°K	$T_{R}$	-	60	-	ms
Fall Time	After 10Lux @2856°K	T <sub>F</sub>	-	25	-	ms

<sup>\*\*</sup>R100, R10: cell resistances at 100Lux and 10 Lux at 2856°K respectively. \*\*\*E100, E10: luminances at 100Lux and 10 Lux 2856°K respectively.

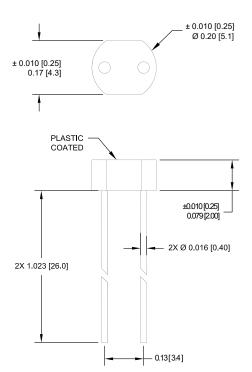

# **Mechanical Specifications**

Units are in inches [mm]





# General Care and Handling Instructions

#### Photodiodes:

Handling and Storage

- · Handle Photodiodes gently to prevent damage.
- Avoid exposing Photodiodes to temperatures exceeding the storage temperature rating of the device.
- Maintain a non-condensing environment for optimum performance and lifetime.

### Cleaning

 Gently clean the glass (borosilicate or quartz window) using a 50/50 mixture of Methanol and isopropyl alcohol and a soft, optical-grade pad.

Special Considerations for Plastic or Epoxy Encapsulated Photodiodes

- · Protect from intense light sources such as direct sunlight.
- Avoid exposure to harsh chemicals like THINNERS, ACETONE, and TRICHLOROETHYLENE.
- Cleaning with a 50/50 mixture of Methanol and isopropyl alcohol (IPA) is recommended. Cleaning in an ultrasonic bath is generally not recommended.

### CdS Photocells:

Handling and Storage

- · Handle CdS Photocells gently to prevent damage.
- Avoid exposing CdS Photocells to temperatures exceeding the storage temperature rating of the device.
- Maintain a non-condensing environment for optimum performance and lifetime.

#### Cleaning

 Gently clean the glass or plastic covering using a 50/50 mixture of Methanol and isopropyl alcohol and a soft, optical-grade pad.

## Special Considerations

 DO NOT use Vapor Phase Soldering or Reflow Soldering for CdS components.

## Optocouplers and LEDs:

Handling and Storage

- Handle Optocouplers and LEDs gently to prevent damage.
- Avoid exposing the devices to temperatures exceeding the storage temperature rating of the device.
- Maintain a non-condensing environment for optimum performance and lifetime.

### Cleaning

 For plastic molded devices, cleaning with a 50/50 mixture of Methanol and isopropyl alcohol is recommended.
Cleaning in an ultrasonic bath is generally not recommended.

## **Special Considerations**

 Avoid exposing plastic molded devices or epoxy glob top devices to harsh chemicals like THINNERS, ACETONE, and TRICHLOROETHYLENE.

# **Legal Disclaimer**

Information in this data sheet is believed to be correct and reliable. However, no responsibility is assumed for possible inaccuracies or omission. Specifications are subject to change without notice.

### Electrostatic Discharge (ESD) Sensitivity:

 All devices are considered ESD-sensitive. They are shipped in ESD protective packaging. When unpacking and using these products, anti-ESD precautions should be observed.

## Lead Trimming and Bending:

 Standard lead trimming after soldering is an acceptable practice; however, do not attempt to bend or modify the leads incorrectly, as it can damage the glass feed-through or the plastic encapsulant.

## Soldering Instructions:

- Use a soldering iron with a tip temperature of 300°C max.
- Consult with your preferred solder manufacturer to determine a solder alloy and flux combination, as well as the reflow profile appropriate for your application.

### General Precautions for all Devices

1. Moisture Prevention:

Ensure devices are stored in a dry environment to prevent moisture ingress, which can cause damage during soldering. Refer to J-STD-20 for guidance on proper baking procedures to prevent moisture related damage.

2. Lead Splaying:

If required, carefully splay the leads of the devices according to the specific application needs. Be cautious when splaying leads, as improper techniques may damage the device. Consult technical support or device datasheets for guidance on lead splaying.

3. Mechanical Stress:

Handle devices with care throughout the installation process to prevent damage.

4. Circuit Protection and Layout:

Optimize the circuit design and layout to ensure proper functioning and prevent damage to the devices. Include appropriate protection measures like ESD protection diodes, current-limiting resistors, and voltage regulation.

5. After-Sale Support:

For troubleshooting and device-specific inquiries, please consult with our technical support team. They can offer valuable guidance and suggestions on handling, operation, and application-related questions. To reach them, please contact the Advanced Photonix Applications group at Techsupport@advancedphotonix.com.

